

# Work Order ID-93998

November-29-12 9:49:54 AM

\*93998\*

Page 1

Item ID: D412-664-203TRN

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Crosstube Turning Detail

Start Date: 29/11/2012 Start Qty: 1.00

\*1\*

Cust Item ID:

Required Date: 13/12/2012 Req'd Qty: 1.00

\*1\*

Customer:

Reference:

Approvals: Process Plan: MCS

Date: 12-11-29

Tooling:

Date:

Run Start \*NR1\*

QC:

Date:

SPC (Y/N):

Date:

Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
----------	--------------

D412-664-243	*Rev E(DEO)
--------------	-------------

100

0.00

\*100\*

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA166

2-Turn first side as per Folio FA166

3- File transition lines smooth.

FOLIO REV: AA

DWG REV: E

amm  
12/12/07

110

QC1- Inspect dimensions to dimension sheet

0.00

\*110\*

QC

Memo

0.00

Quality Control

amm  
12/12/07

NCR: Yes / No

## WORK ORDER NON-CONFORMANCE / UPDATE

DQA: AWD Date: 12/21/14QA Closed: CK Date:

Work Order: <u>93998</u>	<b>DISPOSITION</b> Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input checked="" type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>			
Part No. <u>D412-664-203TRN</u>		Skid-tube <input type="checkbox"/>	Crosstube <input checked="" type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>
NCR No. <u>12-2153</u>		Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>
		Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>
		Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>	12/12/14	100	1	ultrasound Deviation over tol.	DAS 12-89 12/12/14	Within expected tolerance of raw mat'l  Acceptable	DAS 12-89 12/12/14	JCS 12-12-14	DAS 12-89 12/12/14
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input checked="" type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

## FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	---	---	--	---

# Work Order ID 93998

November-29-12 9:49:54 AM

**\*93998\***

Page 2

Item ID: D412-664-203TRN

Accept

**\*N900040100\***

Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Crosstube Turning Detail

Start Date: 29/11/2012 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 13/12/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start **\*NR1\***

QC:

Date:

SPC (Y/N):

Date:

Stop **\*NR2\***

Sequence ID/  
Work Center ID

Operation  
Description

Set Up/  
Run Hours

Tool ID

Tool #

Plan  
Code

Accept  
Qty

Reject  
Qty

Reject  
Number

Insp.  
Stamp

120

MORI SEIKI CNC LATHE LARGE

0.00

**\*120\***

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Turn second side as per Folio FA166  
2- File transition lines smooth.  
3- Remove sand and plugs  
4-Scribe part # and batch # using vibrating stilus  
FOLIO REV: AA  
DWG REV: E

1  $\phi$  KC 12-1209

130

QC1- Inspect dimensions to dimension sheet

0.00

**\*130\***

QC

Memo

0.00

Quality Control

+ PERFORM ULTRA SONIC MEASUREMENT

1  $\phi$  KC 12-1209

140

QC8- Inspect parts - second check

0.00

**\*140\***

QC

Memo

0.00

Quality Control

+ CHECK ULTRA SONIC MEASUREMENT AND ORIENTATION FOR BENDING

JW 12-12-14

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width:100%; border: none;"> <tr> <td style="width:25%;">Skid-tube <input type="checkbox"/></td> <td style="width:25%;">Crosstube <input type="checkbox"/></td> <td style="width:25%;">Water Jet <input type="checkbox"/></td> <td style="width:25%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>						Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>																								
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>																								
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>																								
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																									
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector																		
Doc/Data <input type="checkbox"/>																											
Equip/Tooling <input type="checkbox"/>																											
Operator <input type="checkbox"/>																											
Material <input type="checkbox"/>																											
Setup <input type="checkbox"/>																											
Other <input type="checkbox"/>																											
Process <input type="checkbox"/>																											
Supplier <input type="checkbox"/>																											
Training <input type="checkbox"/>																											
Unapproved <input type="checkbox"/>																											

FAULT CATEGORY			
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other

# Work Order ID 93998

November-29-12 9:49:54 AM

**\*93998\***

Page 3

Item ID: D412-664-203TRN

Accept

**\*N900040100\***

Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Crosstube Turning Detail

Start Date: 29/11/2012 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 13/12/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start **\*NR1\***

QC:

Date:

SPC (Y/N):

Date:

Stop **\*NR2\***

Sequence ID/  
Work Center ID

Operation  
Description

Set Up/  
Run Hours

Tool ID

Tool #

Plan  
Code

Accept  
Qty

Reject  
Qty

Reject  
Number

Insp.  
Stamp

145

0.00

**\*145\***

Crosstubes

Memo

0.00

Crosstubes

GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.

*JW* 12-12-17

150

0.00

**\*150\***

HandFXtube

Memo

0.00

Hand Finishing Crosstubes

1- PRESSURE WASH X-TUBE INSIDE AND OUT

2- ACID ETCH X-TUBE INSIDE AND OUT. USE RED SCOTCH BRITE

*mq/RM* 12-12-17

160

QC5- Inspect part completeness to step on W/O

0.00

**\*160\***

QC

Memo

0.00

Quality Control

*DP* 12-12-17

NCR: Yes / No

## WORK ORDER NON-CONFORMANCE / UPDATE

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions  <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other
---	---	--

# Work Order ID 93998

November-29-12 9:49:54 AM

**\*93998\***

Page 4

Item ID: D412-664-203TRN

Accept

**\*N900040100\***

Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Crosstube Turning Detail

Start Date: 29/11/2012 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 13/12/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start **\*NR1\***

QC:

Date:

SPC (Y/N):

Date:

Stop **\*NR2\***

Sequence ID/  
Work Center ID

Operation  
Description

Set Up/  
Run Hours

Tool ID Tool # Plan Accept Reject Reject Insp.  
Code Qty Qty Number Stamp

170

0.00

**\*170\***

Packaging

Packaging

Memo

0.00

Packaging

Identify and stock in kanban rack  
Location: LG

MO 12/12/17

180

QC21- Final Inspection - Work Order Release

0.00

**\*180\***

QC

Memo

0.00

Quality Control

12/12/18

12.12.18

NCR: Yes / No

## WORK ORDER NON-CONFORMANCE / UPDATE

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other



# Picklist Print

November-29-12 9:49:59 AM

Page 1

Work Order ID: 93998

\*93998\*

Parent Item: D412-664-203TRN

\*D412-664-203TRN\*

Parent Item Name: Crosstube Turning Detail

Start Date: 29/11/2012

Required Date: 13/12/2012

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A 08-03-06 new issue DD verified by:eec  
IPP Rev B 08.04.02 Removed polish EC verified by: DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6009-129		Manufactured	No			120	Each	35.0000	1	1			
**													
*D6009-129*													
Crosstube Material													

## Location

## Loc Qty

## Loc Code

LG015

35

69801

1

75627

23

75630

11

1 mmL 12/12/06


NCR: Yes / No

## WORK ORDER NON-CONFORMANCE / UPDATE

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  <div style="display: flex; justify-content: space-between;"> <div>             Rework <input type="checkbox"/>              Scrap <input type="checkbox"/>              Use-as-is <input type="checkbox"/>              Work Order Update <input type="checkbox"/> </div> </div>	<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>             Skid-tube <input type="checkbox"/>              Machining <input type="checkbox"/>              Thermoforming <input type="checkbox"/>              Large Fab <input type="checkbox"/> </div> <div>             Crosstube <input type="checkbox"/>              Small Fab <input type="checkbox"/>              Finishing <input type="checkbox"/>              Composite <input type="checkbox"/> </div> <div>             Water Jet <input type="checkbox"/>              Prod. Eng. Coord. <input type="checkbox"/>              Rec/Store/Packaging <input type="checkbox"/>              Supplier <input type="checkbox"/> </div> <div>             Engineering <input type="checkbox"/>              Quality <input type="checkbox"/>              Other <input type="checkbox"/> </div> </div>
--	--	---

Root Cause		Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data										
Equip/Tooling										
Operator										
Material										
Setup										
Other										
Process										
Supplier										
Training										
Unapproved										

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other


<b>DART AEROSPACE LTD</b>	<b>Work Order:</b> 93998
<b>Description:</b> Crosstube Assembly (412 High Aft)	<b>Part Number:</b> D412-664-243
<b>Inspection Dwg:</b> D412-664-243 <b>Rev:</b> E	<b>Page 1 of 2</b>

### FIRST ARTICLE INSPECTION CHECKLIST

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.684	+0.005/-0.000	2.687	/		VERN	CNC-08
	2.748	+0.005/-0.000	2.753	/			
	2.884	+0.005/-0.000	2.888	/			
	3.019	+0.005/-0.000	3.023	/			
	3.163	+0.005/-0.000	3.167	/			
	3.308	+0.005/-0.000	3.311	/			
	3.429	+0.005/-0.000	3.429	/			
	2.990	+0.005/-0.000	2.991	/			
	2.618	+0.005/-0.000	2.622	/			
	0.200	+/-0.010	.200	/			
	R0.063	+/-0.010	.063	/		RG	
	R0.500	+/-0.010	.500	/		RG	
	4.971	+/-0.030	4.990	/		VERN	CNC-08
SIDE B	2.684	+0.005/-0.000	2.688	/		VERN	CNC-08
	2.748	+0.005/-0.000	2.753	/			
	2.884	+0.005/-0.000	2.888	/			
	3.019	+0.005/-0.000	3.024	/			
	3.163	+0.005/-0.000	3.167	/			
	3.308	+0.005/-0.000	3.312	/			
	3.429	+0.005/-0.000	3.429	/			
	2.990	+0.005/-0.000	2.994	/			
	2.618	+0.005/-0.000	2.623	/			
	0.200	+/-0.010	.200	/			
	R0.063	+/-0.010	.063	/		RG	
	R0.500	+/-0.010	.500	/		RG	
	4.971	+/-0.030	4.993	/		VERN	CNC-08
	124.100	+/-0.020	124.115	/		tape	LG-15

<b>DART AEROSPACE LTD</b>	<b>Work Order:</b>	<b>93998</b>
<b>Description:</b> Crosstube Assembly (412 High Aft)	<b>Part Number:</b>	<b>D412-664-243</b>
<b>Inspection Dwg:</b> D412-664-243 <b>Rev:</b> E		<b>Page 2 of 2</b>

### WALL THICKNESS MEASUREMENT

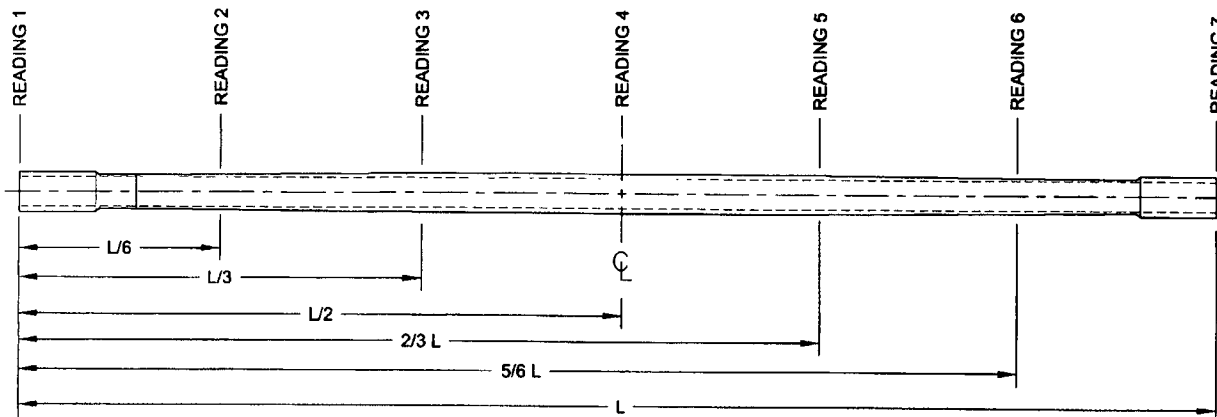

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation $\Delta w$ (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	.382	.387	.389	.382	.007	<div style="display: flex; align-items: center;"> <div style="margin-right: 10px;">✱ Dwg = 0.309"</div> <div>0.073"</div> </div>
READING 2 L= 20.68	.281	.329	.362	.314	.081	
READING 3 L= 41.36	.465	.495	.526	.496	.061	
READING 4 L= 62.05	.630	.633	.647	.641	.017	
READING 5 L= 82.73	.476	.498	.508	.486	.032	
READING 6 L= 103.41	.298	.326	.346	.318	.048	
READING 7 L= 124.100	.377	.368	.385	.394	.026	

#### Calibration Result

Actual Block Thickness: 250.750

Sitescan 250 Measured Thickness: 250.750

<b>Measured by:</b>	<u>KC</u>
<b>Date:</b>	<u>12-12-09</u>

<b>Audited by:</b>	<u>JW</u>
<b>Date:</b>	<u>12-12-14</u>

<b>Preliminary Approval:</b>	
<b>Date:</b>	

Rev	Date	Change	Revised by	Approved
A	04.06.16	New Issue (P/O D412-664-203)	KJ/JLM	
B	06.03.09	Dwg Rev updated	KJ/JLM	
C	07.05.08	Tolerance updated for dimension 4.971	KJ/JLM	
D	10.02.02	Dimension 124.100 was 124.09	KJ	
E	12.06.04	Wall thickness form added	KJ	<u>HA</u>

Item	Qty -243	Part Number	Description
1	X	D412-664-243	CROSSTUBE ASSEMBLY (412 HIGH AFT)
2	1	D6009-129	CROSSTUBE
3	2	D3595-063-570	RUBBER CUSHION
4	1	D2896-1	SUPPORT
5	2	D3189-1	CHAFING SHIELD
6	2	D2856-600-1009	ABRASION STRIP
7	4	MS21920-28	CLAMP
8	2	MS21920-30	CLAMP (OR MS21920-32)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION R80-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)


# **GENERAL NOTES:**

- 1) MATERIAL: MANUFACTURED FROM D6009-129  
FINISHED LENGTH = 124.100±0.020 (BEFORE BENDING/TRIMMING)
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4 1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4 2  
PAINT OUTSIDE PER DART QSI 005 4 2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D412-664-243" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 47.0 lbs (PER IIN-D212-664)
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2896-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2896-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-30 CLAMPS (OR -32) WITH D3595-063-570 RUBBER CUSHIONS TO SECURE THE D2896-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT.
- 14) INSTALL D2856-600-1009 ABRASION STRIPS WITH A 0.13 REF GAP ON BOTTOM SIDE OF CROSSTUBE PER QSI 035.
- 15) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.


E	REFORMAT/REVISE GENERAL NOTES; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; RELOCATED FLAG #6 PER PAR 08-046 (ZN A6-3); ADD TOLERANCE (ZN B6-3, C4-3, C8-3 & C5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	09.09.30
D	REMOVE D2732-058, CHANGE TO D3595-063-570	PH	07.03.09
C	REMOVE D2856-600-1087, ADD D2732-058 & MAGNOBOND 6398, MS21920-32 WAS MS21920-30	MB	06.10.27
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	01.10.17
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	<b>DART AEROSPACE LTD</b> HAWKESBURY, ONTARIO, CANADA DRAWING NO. REV. E D412-664-243 SHEET 1 OF 4 TITLE SCALE CROSSTUBE ASSEMBLY (412 HI AFT) NTS <small>COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	
DRAWN	RF		
CHECKED	PH		
MFG. APPR.	PH		
APPROVED	PH		
DE APPR.	PH		
DATE	09.09.30		

93998.MLS  
12-11-29  
② DEO ATTACHED  
RELEASED  
2009-10-29


93998

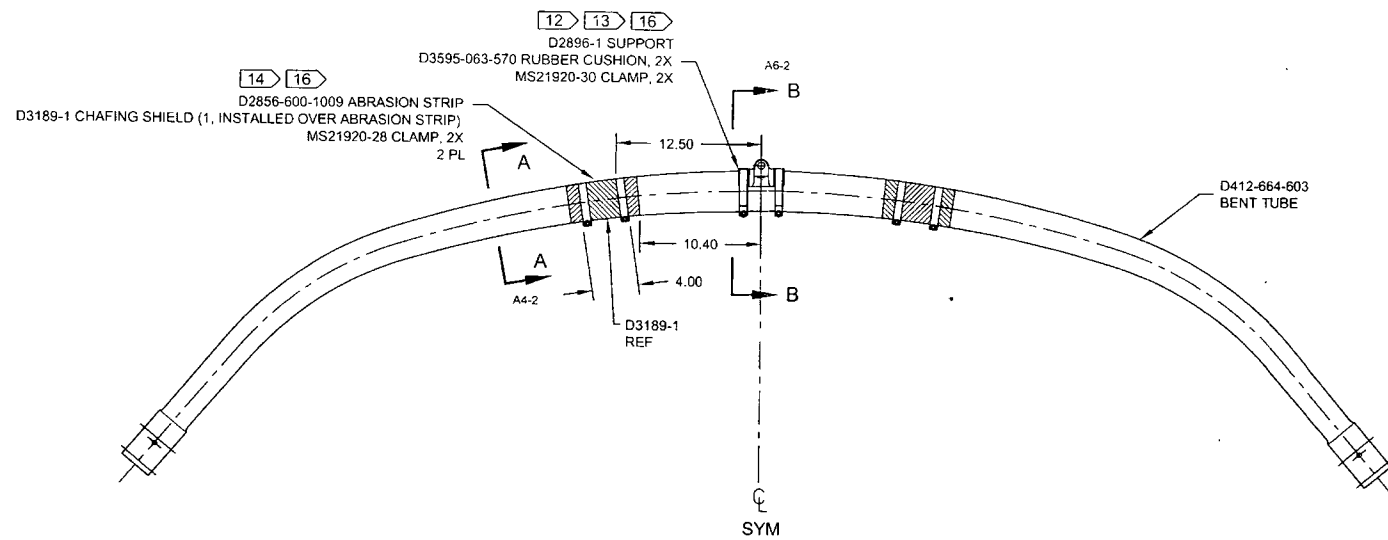

**D212-664-243**  
**ASSEMBLY DETAIL** E

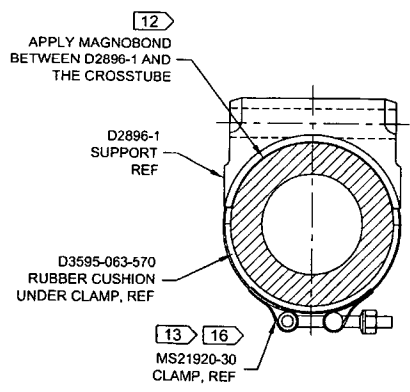

**SECTION B-B** D4-2  
SCALE 4X

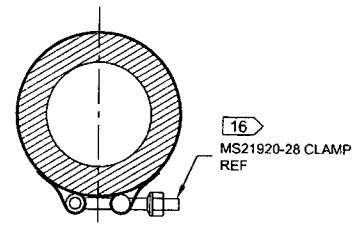


**SECTION A-A** C6-2  
SCALE 4X

2 DEO ATTACHED

**RELEASED**  
2009-10-28  
MR

DESIGN	PH	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	Q	DRAWING NO.	REV. E
MFG. APPR.	S	D412-664-243	SHEET 2 OF 4
APPROVED	AP	TITLE	SCALE
DE APPR.	H	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	<small>COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD</small>	


93998

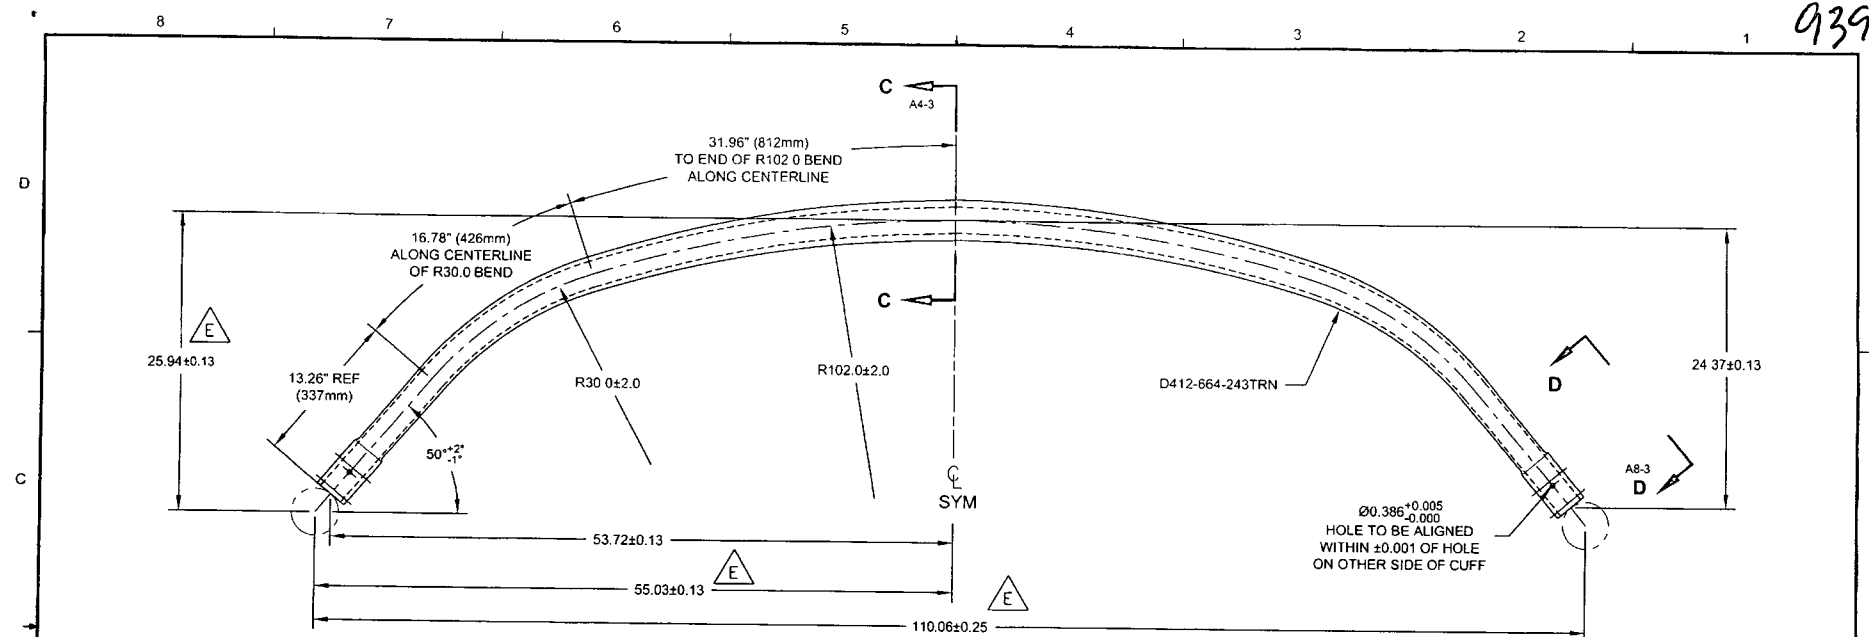


**D412-664-603** 10  
**BENDING AND DRILLING DETAIL** E

② DEO ATTACHED

**RELEASED**  
 2009-10-29  
 MP

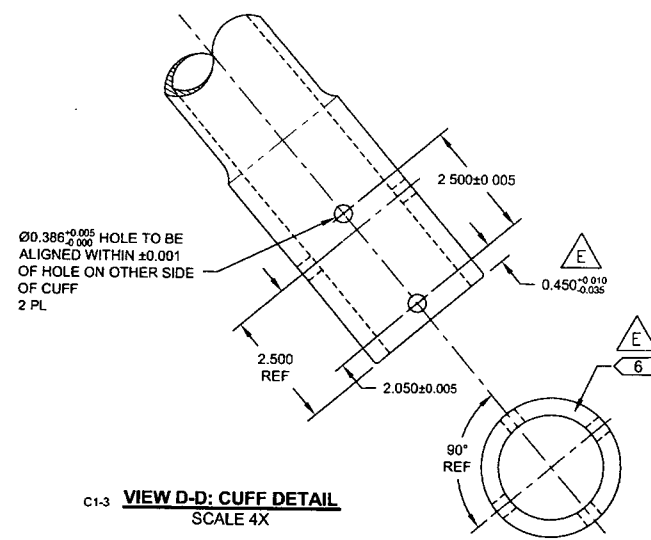


**C1-3 VIEW D-D: CUFF DETAIL**  
 SCALE 4X

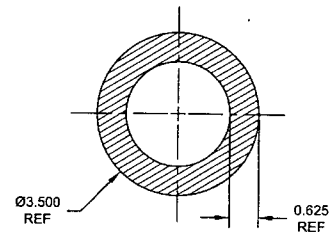

**SECTION C-C** D5-3  
 SCALE 4X



DESIGN	PH	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	98	DRAWING NO.	REV. E
MFG. APPR.	DS	D412-664-243	SHEET 3 OF 4
APPROVED	AP	TITLE	SCALE
DE APPR	TH	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2001 BY DART AEROSPACE LTD <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

43498

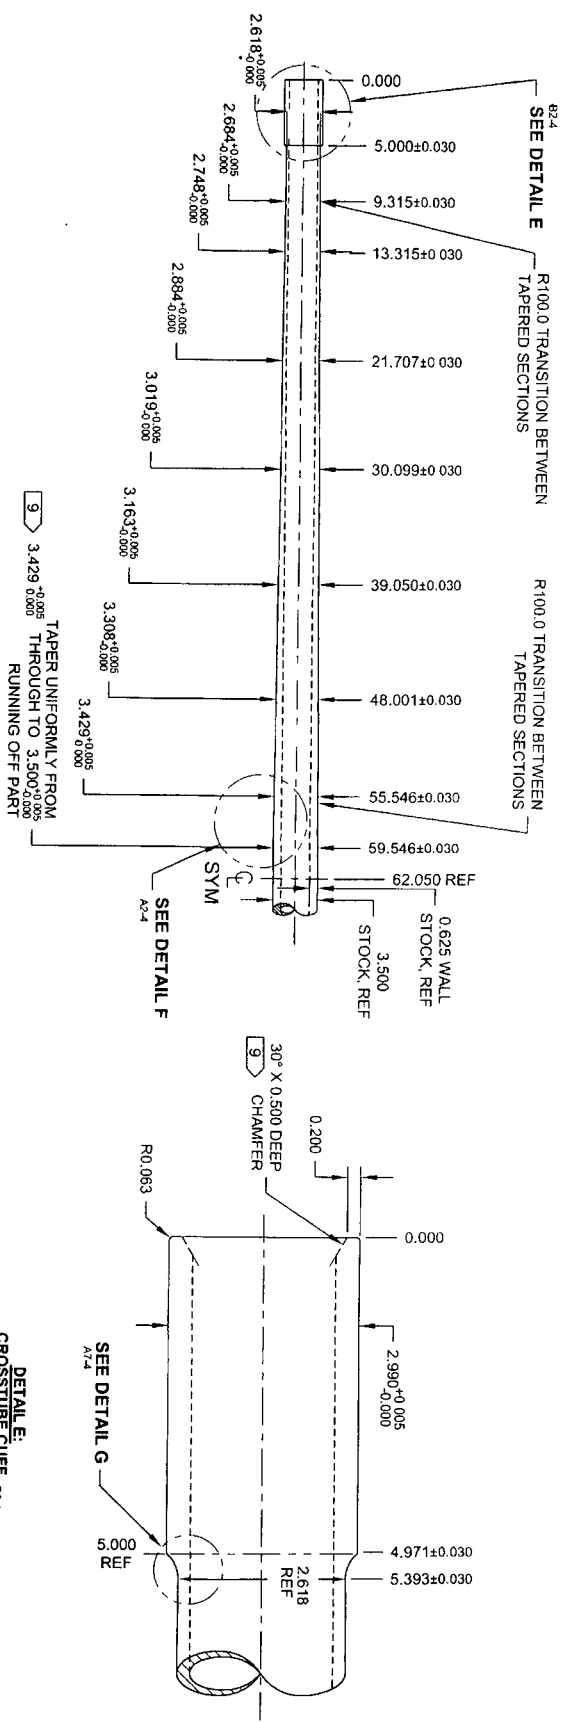

D412-664-243TRN  
TURNING DETAIL E

DETAIL E:  
CROSSTUBE CUFF  
SCALE 3X

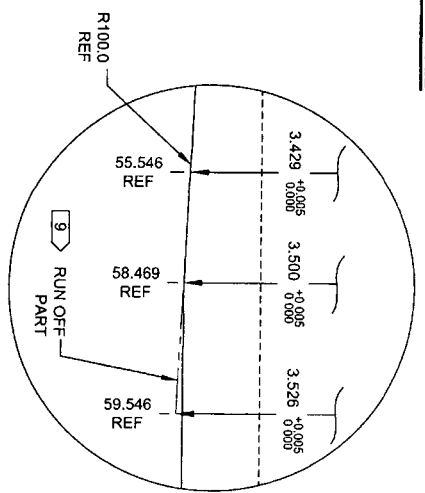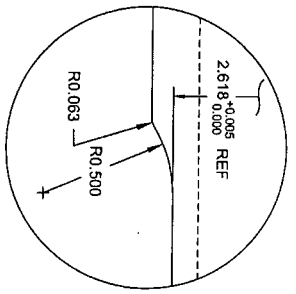

DETAIL F:  
TAPER RUN-OFF  
SCALE 3X

DESIGN	RE	DART AEROSPACE LTD
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA
CHECKED	Q	DRAWING NO.
MFG. APPR.	Q	D412-664-243
APPROVED	Q	TITLE
DE APPR.	Q	CROSSTUBE ASSEMBLY (412 HI AFT)
DATE	09.09.30	SCALE
		NTS

DEO ATTACHED  
RELEASED  
2009-10-29  
NNT

COPYRIGHT © 2001 BY DART AEROSPACE LTD  
ALL RIGHTS RESERVED. NO PART OF THIS DOCUMENT IS TO BE REPRODUCED OR TRANSMITTED IN ANY FORM OR BY ANY MEANS, ELECTRONIC OR MECHANICAL, INCLUDING PHOTOCOPYING, RECORDING, OR BY ANY INFORMATION STORAGE AND RETRIEVAL SYSTEM.



93998

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASSEMBLY (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D412-664-243-E-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN	CHECKED	MFG. APPR.	APPROVED	DE APPR.			
DATE 11.03.31	DATE 11/03/31	DATE 11.03.31	DATE 11/03/31	DATE 11.03.31			

**PURPOSE:**  
REMOVED ABRASION STRIP IN FAVOR OF A THIN LAYER OF PROSEAL 890.

**CHANGE:**

PARTS LIST IS AMENDED AS FOLLOWS:

**IS:**

Item	Qty -243	Part Number	Description
6	0	D2856-600-1009	ABRASION STRIP

**WAS:**

6	2	D2856-600-1009	ABRASION STRIP
---	---	----------------	----------------

NOTES 2 AND 14, SHEET 1 ARE AMENDED AS FOLLOWS:

**IS:**

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA)  
PAINT OUTSIDE PER DART QSI 005 4.2  
AFTER PAINTING, APPLY CLEAR COAT ON HATCHED AREA
- 14) APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3189-1  
CHAFING SHIELD AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL  
PROSEAL D3189-1 CHAFING SHIELD ONTO CROSSTUBE BY APPLYING A THIN COAT OF  
PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.

**WAS:**

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 14) INSTALL D2856-600-1009 ABRASION STRIPS WITH A 0.13 REF GAP ON BOTTOM SIDE OF  
CROSSTUBE PER QSI 035.

RELEASED  
2011-04-07  
WDP





93998

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASS'Y (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D412-664-243-E-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN 97	CHECKED ASS	MFG. APPR. E	APPROVED MP		DE APPR. H		
DATE 11.09.07	DATE 11.09.19	DATE 11.09.19	DATE 11.09.19		DATE 11.09.19		

**PURPOSE:**

REPLACE MAGNOBOND WITH 3M DP460 SCOTCH-WELD EPOXY ADHESIVE

**CHANGE:**

IS:

Item	Qty -243	Part Number	Description
9	A/R	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD

WAS:

9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	----------------	---

NOTE 12 &amp; 16, SHEET 1 IS AMENDED AS FOLLOWS:


IS:

- 12) INSTALL D2896-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015. LET CURE FOR 24 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVE HAS CURED FOR 24 HOURS.**

WAS:

- 12) INSTALL D2896-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2896-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

**RELEASED**  
2011-09-29  
MP

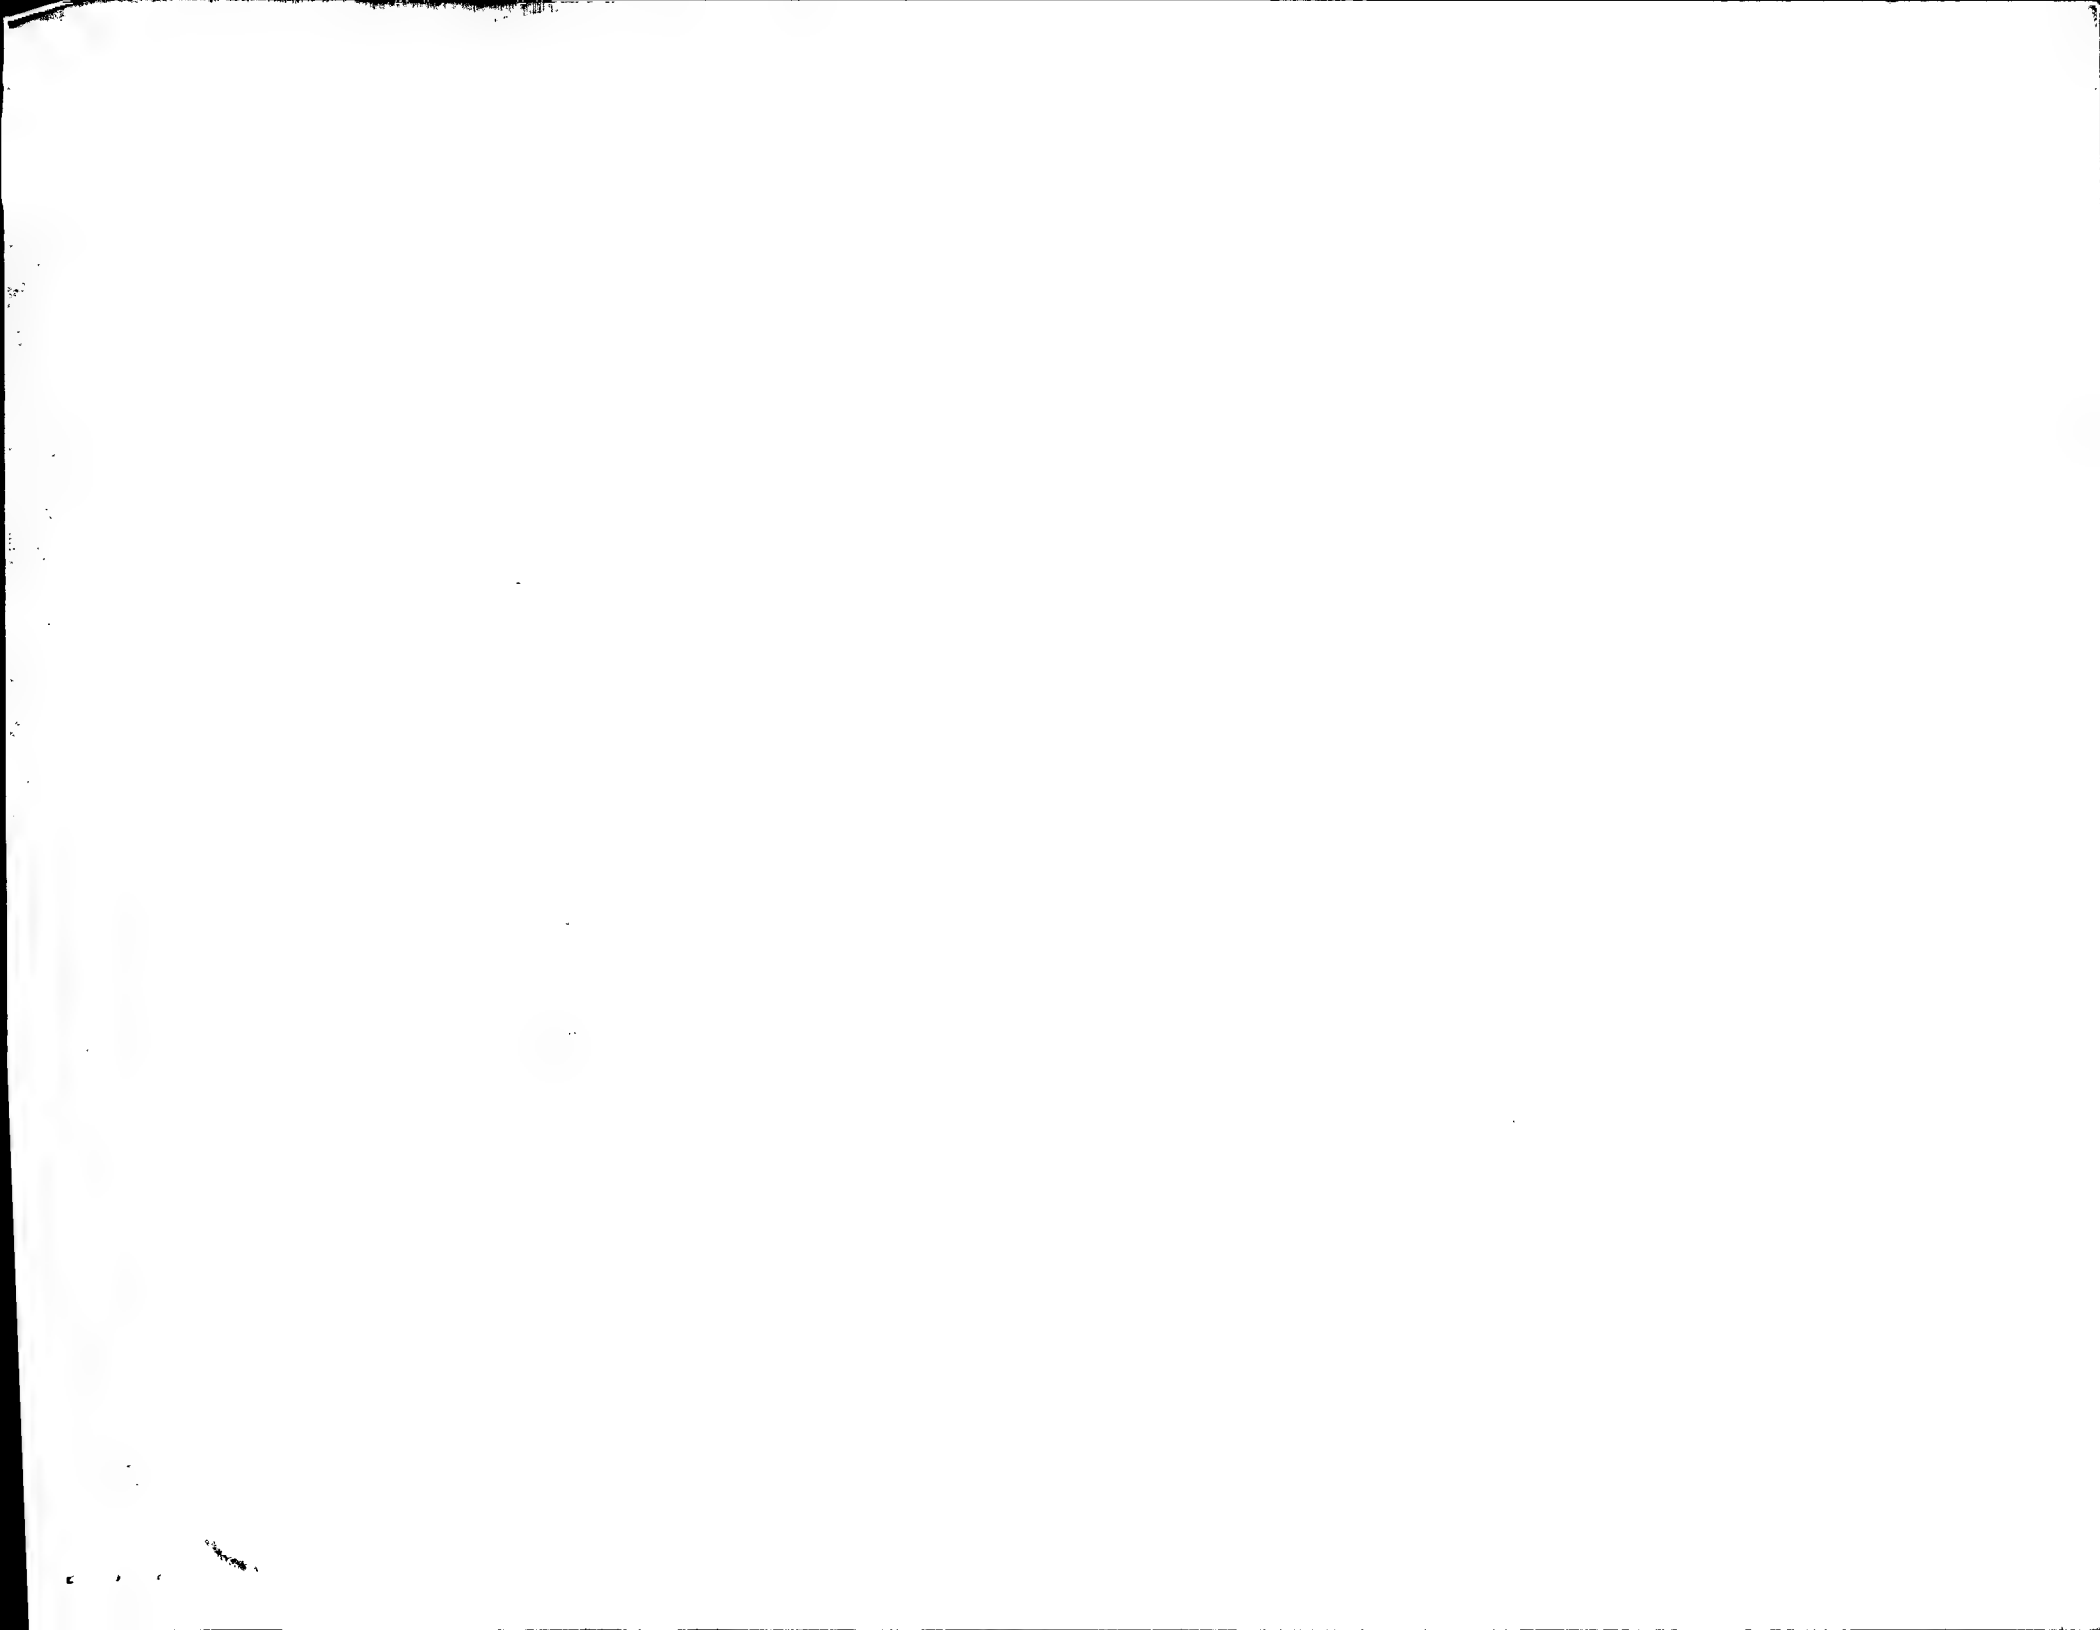

93998

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASSEMBLY (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D412-664-243-E-4	SHEET NO. SHEET 1 OF 3	SCALE NTS
DRAWN 97	CHECKED A	MFG. APPR. A	APPROVED MP		DE APPR. A		
DATE 12.08.21	DATE 12.08.30	DATE 12.08.30	DATE 12/8/30		DATE 12.08.30		

**PURPOSE:**

REMOVED ABRASION STRIP IN FAVOR OF A THIN LAYER OF PROSEAL 890. UPDATE INSTALLATION OF CHAFING SHIELDS AND REDUCE TORQUE TO 40-50 IN-LBS. THIS ENGINEERING ORDER SUPERCEDES DEO D412-664-243-E-1.

**CHANGE:**

**PARTS LIST IS AMENDED AS FOLLOWS:**

**IS:**

Item	Qty -243	Part Number	Description
6	0	D2856-600-1009	ABRASION STRIP

**WAS:**

6	2	D2856-600-1009	ABRASION STRIP
---	---	----------------	----------------

**NOTES 2, 14, AND 16 ON SHEET 1 ARE AMENDED AS FOLLOWS:**

**IS:**

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA)  
PAINT OUTSIDE PER DART QSI 005 4.2  
AFTER PAINTING, APPLY CLEAR COAT ON HATCHED AREA
- 14) APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3189-1 CHAFING SHIELD AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL PROSEALED D3189-1 CHAFING SHIELD ONTO CROSSTUBE BY APPLYING A THIN COAT OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.
- 16) TORQUE CLAMPS ON D2896-1 SUPPORT 80 TO 100 IN-LB. **TORQUE CLAMPS ON D3189-1 CHAFING SHIELD 40 TO 50 IN-LB.** ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

**WAS:**

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 14) INSTALL D2856-600-1009 ABRASION STRIPS WITH A 0.13 REF GAP ON BOTTOM SIDE OF CROSSTUBE PER QSI 035.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.


**RELEASED**  
2012-09-04  
MP

93998

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASSEMBLY (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D412-664-243-E-4	SHEET NO. SHEET 2 OF 3	SCALE NTS
DRAWN 90	CHECKED	MFG. APPR.	APPROVED	DE APPR.		
DATE 12.08.21	DATE 12.08.27	DATE 12.08.29	DATE 12.08.29	DATE 12.08.29		

**IS:**

D3189-1 CHAFING SHIELD (1, INSTALLED OVER PROSEAL 890)  
MS21920-28 CLAMP, 2X  
2 PL

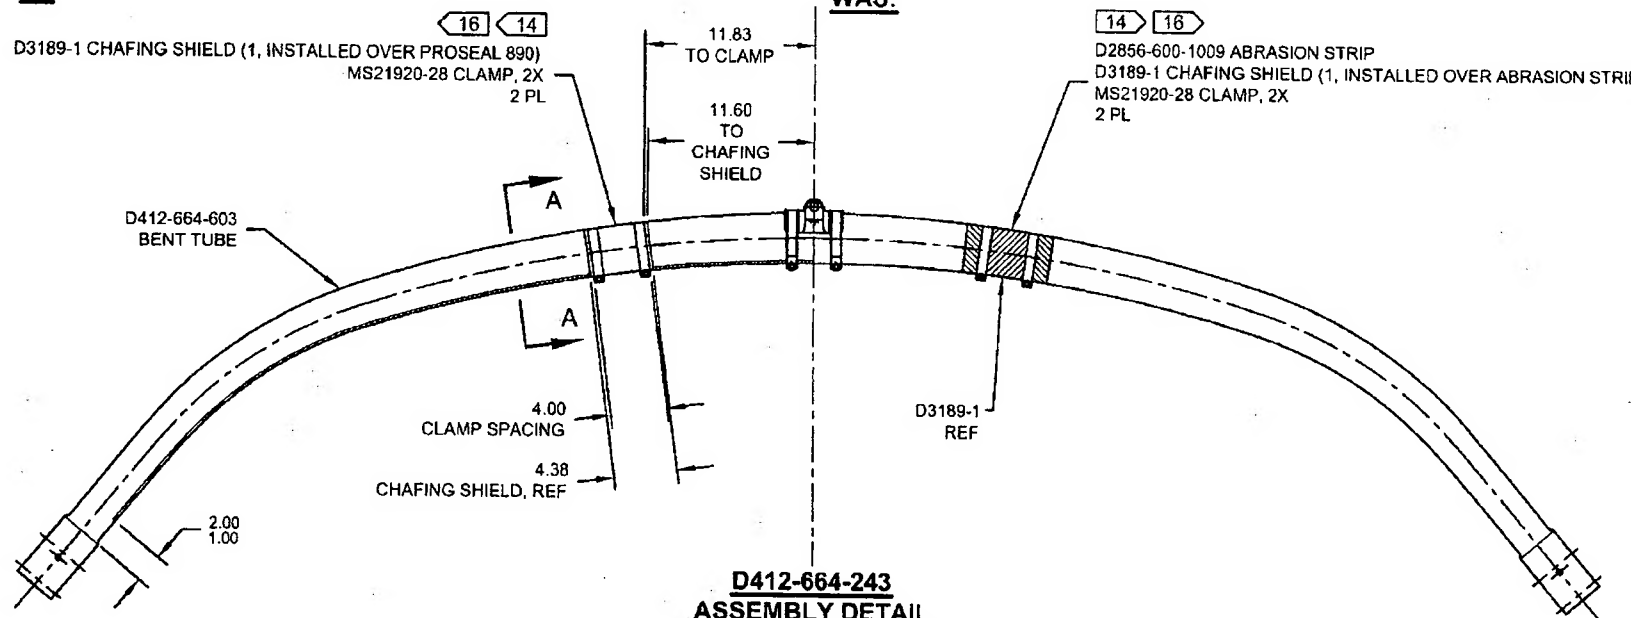


**WAS:**

D2856-600-1009 ABRASION STRIP  
D3189-1 CHAFING SHIELD (1, INSTALLED OVER ABRASION STRIP)  
MS21920-28 CLAMP, 2X  
2 PL

**D412-664-243  
ASSEMBLY DETAIL**

MASK AREA PRIOR TO PAINTING AND  
APPLY CLEAR COAT AFTER PAINTING

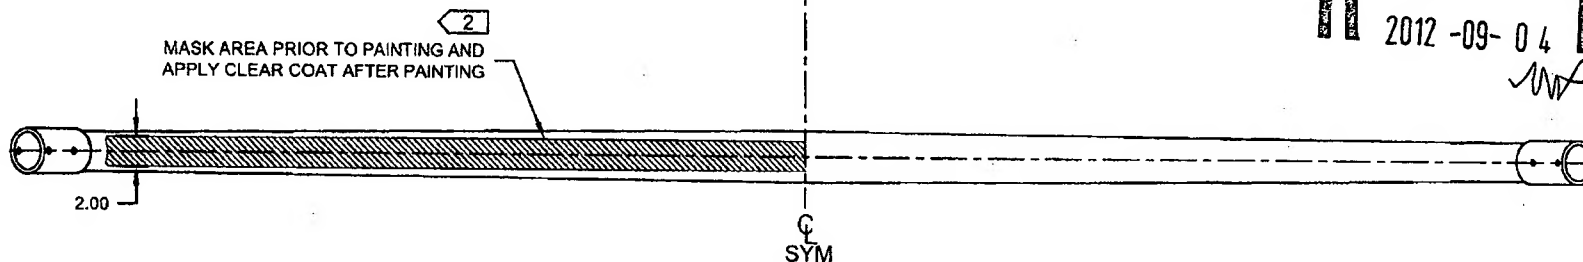


**RELEASED**  
2012-09-04

COPYRIGHT © 2012 BY DART AEROSPACE LTD  
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS  
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT  
WRITTEN PERMISSION FROM DART AEROSPACE LTD.

9399 8

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASSEMBLY (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D412-664-243-E-4	SHEET NO. SHEET 3 OF 3	SCALE NTS
DRAWN 92	CHECKED	MFG. APPR.	APPROVED	DE APPR.		
DATE 12.08.21	DATE 12.08.22	DATE 12.08.29	DATE 12.08.29	DATE 12.08.29		

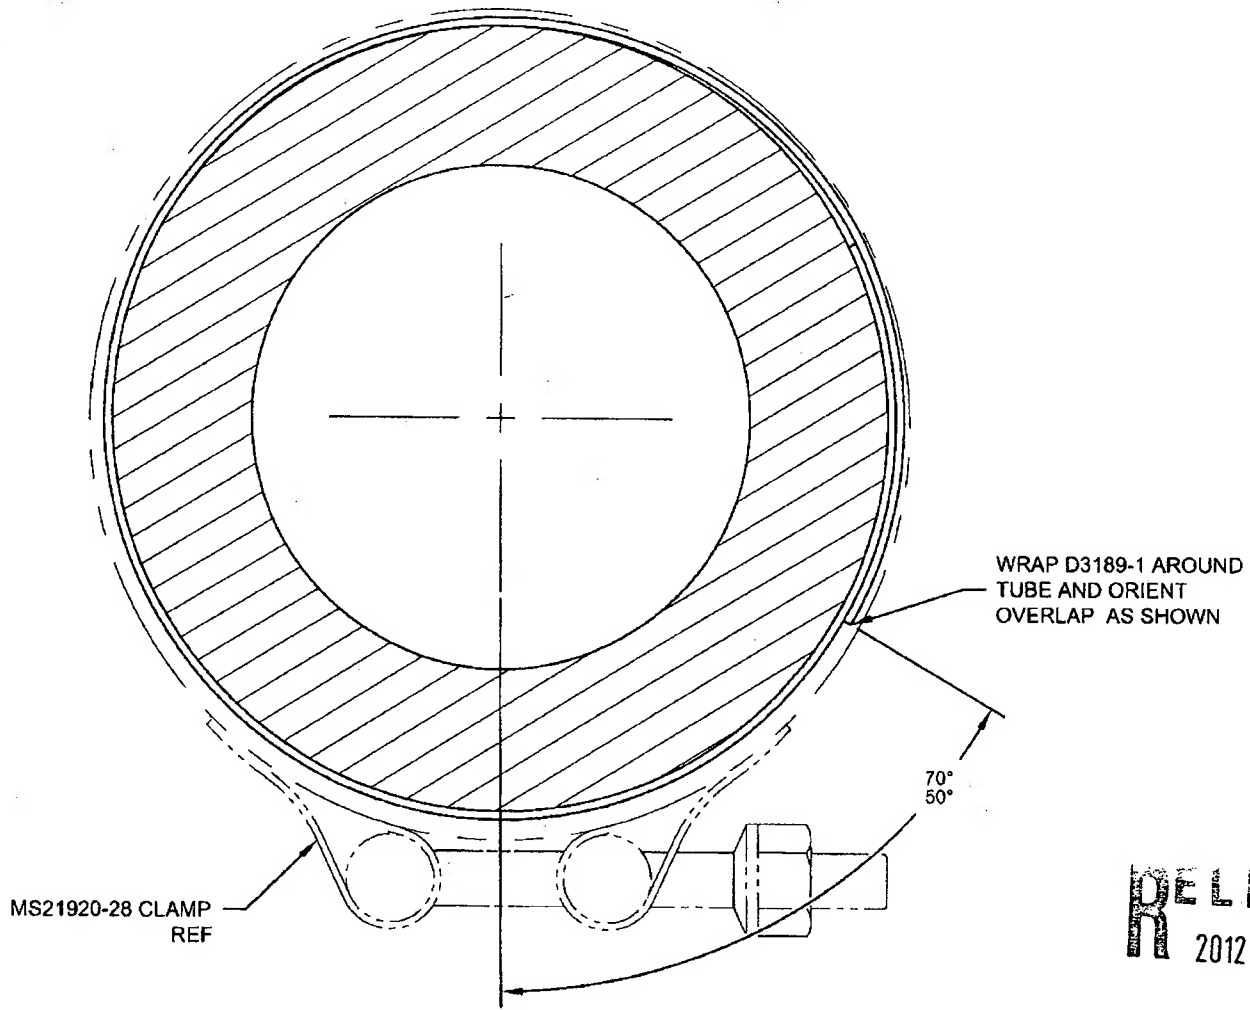

**SECTION A-A**  
CHAFING SHIELD DETAIL  
VIEW ROTATED, NOT TO SCALE

RELEASED  
2012-09-04  
MD

COPYRIGHT © 2012 BY DART AEROSPACE LTD  
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS  
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT  
WRITTEN PERMISSION FROM DART AEROSPACE LTD.



